

LCD 2009 01 03 Date of Issue: 12th January 2009 Classification: White

Page 1 of 1

MODELS LC26D44E LC32D44E

- **<u>SYMPTOM</u>** No function or backlight, green LED on.
- **CAUSE** R8408 high resistance/cracked.
- **ACTION** Check the value of R8408 and if high replace.

<u>REF NO</u>	DESCRIPTION	PART NUMBER	PRICE CODE
R8408	SMD Resistor, 0.33Ω	VRS-TW2HPR33JY	AA

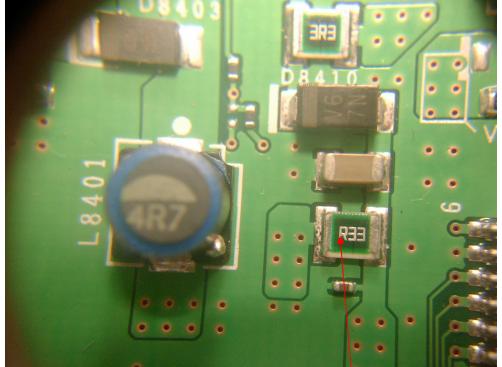


Figure 1: Location of R8408.

Sharp Electronics (UK) Limited

Reference – LV278 Revision - 1

White – Carry out as required Yellow – Carry out as required and whenever the unit comes in for service Red – Carry out on all units